

Roy F. Weston, Inc. Federal Programs Division Suite 201 1090 King Georges Post Road Edison, New Jersey 08837-3703 908-225-6116 • Fax 908-225-7037

231268

SUPERFUND TECHNICAL ASSESSMENT AND RESPONSE TEAM EPA CONTRACT_68-W5-0019

February 19, 1999

Dan Harkay U.S. Environmental Protection Agency Removal Action Branch 2890 Woodbridge Avenue Edison, NJ 08837

EPA CONTRACT NO: 68-W5-0019

TDD NO: 02-98-08-0053

DOCUMENT CONTROL NO: START-02-F-03240

SOIL AND SEDIMENT SAMPLING AND ANALYSIS SUMMARY REPORT, SUBJECT:

ADDENDUM NO. 1 - CORNELL DUBILIER ELECTRONICS - BOUND

BROOK

Dear Mr. Harkay:

Enclosed please find Addendum No. 1 to the Soil And Sediment Sampling and Analysis Summary Report for the Cornell Dubilier Electronics - Bound Brook project. If you have any questions or comments, please call me at (732) 225-6116.

Very truly yours,

M. Make /

ROY F. WESTON, INC.

Michael Mahnkopf

Project Manager

Enclosure

TDD File cc:



SOIL AND SEDIMENT SAMPLING AND ANALYSIS SUMMARY REPORT

ADDENDUM NO. 1

CORNELL DUBILIER ELECTRONICS - BOUND BROOK SOUTH PLAINFIELD, MIDDLESEX COUNTY, NEW JERSEY

Prepared by

Superfund Technical Assessment and Response Team Roy F. Weston, Inc. Federal Programs Division Edison, New Jersey 08837

Prepared for

U.S. Environmental Protection Agency Region II - Removal Action Branch Edison, New Jersey 08837

DCN #: START-02-F-03240 TDD #: 02-98-08-0053 EPA Contract No.: 68-W5-0019

Approved by:	
START	
My Mahalegel	Date: 2/19/99
Michael Mahnkopf	
Project Manager	
START Level for To'w Thomas O'Neill Group Leader	Date: 2/14/99
EPA	
	Date:
Dan Harkay	

On-Scene Coordinator

TABLE OF CONTENTS

1

1.0	BACI	KGROUND .	
2.0	OBJE	CTIVES	
3.0	SAM	PLING DESIG	GN AND APPROACH
4.0	SAM	PLING AND	ANALYSIS - NOVEMBER 21, 1998
5.0	SITE	SPECIFIC Q	UALITY ASSURANCE/QUALITY CONTROL PLAN
	5.1 5.2 5.3 5.4	Chain of Cu Quality Asso Sample QA	quipment and Methods
6.0			ON
7.0	DISC	CUSSION	
			LIST OF TABLES
TAB	LE 1:		Cornell-Dubilier Electronics, South Plainfield, NJ; Bound Brook Soil/Sediment Sampling & Analysis; November 21, 1998
*			LIST OF APPENDICES
APP	ENDIX	1:	Site Maps/Figures
APP	ENDIX	2:	Analytical Results (Form I's) & Data Validation Results; November 21, 1998

1.0 BACKGROUND

The Cornell-Dubilier Site is located at 333 Hamilton Boulevard in South Plainfield, Middlesex County, New Jersey (Appendix 1, Figure 1). The site is approximately 25 acres in size. Facing Hamilton Boulevard are several buildings currently occupied by approximately 15 businesses. The rear of the property consists of an open field and adjoining wetlands. The facility is currently known as Hamilton Industrial Park.

The site is bordered by Hamilton Boulevard to the northwest, Spicer Avenue to the southwest, a wetlands area to the southeast, the Bound Brook and Conrail railroad tracks to the northeast. The Bound Brook traverses the southeast section of the site.

Cornell-Dubilier operated at the site from 1936 to 1962, manufacturing electronic components, including capacitors. It is alleged that during its operation, Cornell-Dubilier disposed of polychlorinated biphenyls (PCB) contaminated materials and other hazardous substances at the site.

Previous investigations have identified PCBs at the Cornell-Dubilier site and in the Bound Brook downstream of the site. Water, sediment and fish samples were collected from the Bound Brook at one (1) location adjacent to the site, three (3) locations between the site and New Market Pond, and two (2) locations in New Market Pond. Samples were also collected from one (1) location upstream of the site.

Sampling events were conducted on neighboring residential and commercial areas in June and October, 1997 and April and May, 1998. The purpose was to identify off-site migration of contaminants from the Cornell-Dubilier site on these surrounding areas.

Sampling events were conducted along the Bound Brook floodplain in August, September, October, November and December, 1997 to identify PCB contamination upstream, midstream, and/or downstream of the Cornell-Dubilier site.

2.0 OBJECTIVES

The objective of this sampling program was to confirm elevated total PCB concentrations exhibited at specific locations along the Bound Brook floodplain. Initial PCB data was generated during the previous investigations conducted during the summer/fall, 1997, as referenced above in Section 1.0.

3.0 SAMPLING DESIGN AND APPROACH

See Section 3.0 of the "Soil And Sediment Sampling And Analysis Summary Report", DCN # START-02-F-01559, dated September 7, 1998.

4.0 SAMPLING & ANALYSIS - NOVEMBER 21, 1998

Soil/sediment sampling activities were performed on November 21, 1998 by the following personnel:

- 1. Dan Harkay USEPA, Region II
- 2. Michael Mahnkopf START, Region II

All soil/sediment samples were collected utilizing dedicated plastic scoops and/or spatulas and stainless steel hand augers. The stainless steel hand augers were decontaminated between boreholes in accordance with the procedures outlined in the "Sampling Equipment Decontamination EPA/ERT SOP #2006" document. All samples were analyzed by Ecology & Environment, Inc., 4493 Walden Avenue, Lancaster, NY 14086, (716) 685-8080. For additional information, see project logbook # START-02-209.

On November 21, 1998, the following sample locations were re-sampled: CCSD1(Transect CC), DDSS1(Transect DD), HHSD1(Transect HH), PPPND2 (Transect PPP) and UUUSD1 (Transect UUU). One (1) surface soil sample and four (4) subsurface soil samples were collected and analyzed for total PCBs.

QA/QC samples included the collection of one (1) field duplicate sample (UUUSD3-a - dupl. of UUUSD1-a) and one (1) matrix spike/matrix spike duplicate sample (UUUSD1-a MS/MSD). These QA/QC samples were analyzed for total PCBs.

Analytical results are summarized in Table 1 and have been added to Figures 5, 6 and 8 of the "Soil And Sediment Sampling And Analysis Summary Report", DCN # START-02-F-01559, dated September 7, 1998. Qualifiers associated with the analytical results are discussed in the data validation package. The laboratory Form I's and data validation package are included as Appendix 2.

5.0 SITE SPECIFIC QUALITY ASSURANCE/QUALITY CONTROL PLAN

The objective of this QA/QC plan is to provide analytical results which are legally defensible in a court of law. The QA/QC plan incorporated procedures for field sampling, chain of custody, laboratory analyses, and reporting to assure generation of sound analytical results. Sampling procedures were conducted in accordance with USEPA protocols.

5.1 Sampling Equipment and Methods

Samples were collected at the locations and depths as described in this report. Procedural changes dictated by field conditions were fully documented in the field notes.

Equipment utilized for this project were dedicated plastic scoops and spatulas and stainless steel hand augers. All soil samples were transferred immediately after collection into sample bottles selected by parameter as listed below. Sample bottles used for this project were prepared in accordance with USEPA criteria for polychlorinated biphenyls (PCBs).

The type of sample container required for the Cornell Dubilier Electronics/Bound Brook soil investigation was as follows:

a. Polychlorinated Biphenyls - 8 oz. glass bottle with teflon closure.

All soil samples were packed on ice immediately following collection.

All samples were labeled with the following information:

- a. sample number;
- b. date and time of collection;
- c. site name:
- d. sample collector's initials;
- e. analyses required.

Accurate field notes were maintained which included the information listed above. Additional information included, but was not limited to:

- a. sample location sketch;
- b. sample method;
- c. general comments, including any modification from the sample plan.

5.2 Chain of Custody

Chain of custody was maintained for all samples. Chain of custody originated with the collection of the samples and was maintained until the samples were relinquished to the laboratory. The chain of custody form detailed the following information:

- a. sample identification number;
- b. sample collection date and time;
- c. sample matrix;
- d. expected contaminant concentration (low, medium, high);
- e. sample type (grab or composite);
- f. sample preservation;
- g. analytical parameters;
- h. name(s) and signatures(s) of sampler(s);
- i. signatures(s) of individual(s) with control over samples.

5.3 Quality Assurance/Quality Control Samples

The matrix for all samples included in this investigation were soil. QA/QC samples included the collection of one (1) field duplicate and one (1) matrix spike/matrix spike duplicate sample for each matrix (soil) per sampling date at a ratio of one (1) per twenty (20) samples. Extra volume was submitted to allow the laboratory to perform matrix spike sample analysis. This analysis provides information about the effect of sample matrix digestion and measurement methodology. Field duplicate samples provide an indication of sample homogeneity and were not identified to the laboratory.

In addition, one (1) rinsate blank per sampling date was also be submitted for PCB analysis. The rinsate blank is an indicator of the effectiveness of the equipment decontamination procedures.

5.4 Sample QA/QC Data

CLP format deliverable QA/QC packages were provided by Ecology & Environment, Inc. for all samples submitted for analysis.

6.0 DATA VALIDATION

Data was evaluated according to criteria contained in the Removal Program Data Validation Procedures that accompany OSWER Directive number 9360.4-1 and in accordance with Region II guidelines using the following data validation SOP: SOP HW-13. Laboratory analytical results were assessed by the data reviewer for compliance with required precision, accuracy, completeness, representativeness, and sensitivity.

Data validation was performed by START, Region II in accordance with Level QA-2 criteria. Data validation results indicate that the analytical results are acceptable with comments. For specific comments, see the Data Validation Results included as Appendix 2.

7.0 DISCUSSION

As summarized in the "Soil And Sediment Sampling And Analysis Summary Report", DCN # START-02-F-01559, dated September 7, 1998, total PCB concentrations were exhibited by soil and sediment samples collected from Reaches 1 through 9 of the Bound Brook floodplain. Mean total PCB concentrations were previously calculated for the areas described below.

As summarized in Table 1 of this report, the re-sampled locations also exhibited total PCB concentrations. Based upon these additional analytical results, the mean total PCB concentrations have been revised and are stated below. For statistical purposes, the method detection limit (MDL) was utilized for samples which did not exhibit total PCB concentrations.

- 1. Surface (0-6" depth interval) soil samples collected from the north and south banks of the Bound Brook. The revised mean total PCB concentration is 6.88 parts per million (ppm). This concentration represents a decrease when compared to the original mean concentration of 7.59 ppm.
- 2. Subsurface (depth interval varied) soil samples collected from the north and south banks of the Bound Brook. The revised mean total PCB concentration is 12.28 ppm. This concentration represents an increase when compared to the original mean concentration of 11.97 ppm.
- 3. Surface (0-6" depth interval) sediment samples collected from the stream bed of the Bound Brook. Mean total PCB concentration remained unchanged at 2.93 ppm.
- 4. Subsurface (depth interval varied) sediment samples collected from the stream bed of the Bound Brook. Mean total PCB concentration remained unchanged at 2.34 ppm.

TABLE 1

CORNELL-DUBILIER ELECTRONICS SOUTH PLAINFIELD, NJ BOUND BROOK SOIL SAMPLING & ANALYSIS


NOVEMBER 21, 1998


SAMPLE ID	MATRIX	ДЕРТН	DATE/ TIME	ANALYSIS/ RESULT (ppm)	LOCATION
CCSD1-a	Soil	18-24"	11/21/98 1000 hrs.	Total PCB/ 580 J	Transect CC
DDSS1-a	Soil	0-6"	11/21/98 1005 hrs.	Total PCB/ 250	Transect DD
HHSD1-a	Soil	12-18"	11/21/98 1025 hrs.	Total PCB/ 510	Transect HH
UUUSD1-a	Soil	18-24"	11/21/98 1045 hrs.	Total PCB/ 2.1	Transect UUU
UUUSD1-a MS/MSD	Soil	18-24"	11/21/98 1045 hrs.	Total PCB/ N/A	Matrix spike/ Matrix spike dupl
UUUSD3-a	Soil	18-24"	11/21/98 1045 hrs.	Total PCB/	Duplicate of UUUSD1-a
PPPND2-a	Soil	18-24"	11/21/98 1120 hrs	Total PCB/ 250	Transect PPP
RB-1	Aqueous	N/A	11/21/98 1100 hrs.	Total PCB/ ND	Rinsate Blank

Qualifiers:

J = estimated value ND = not detected

APPENDIX 1 SITE MAPS/FIGURES

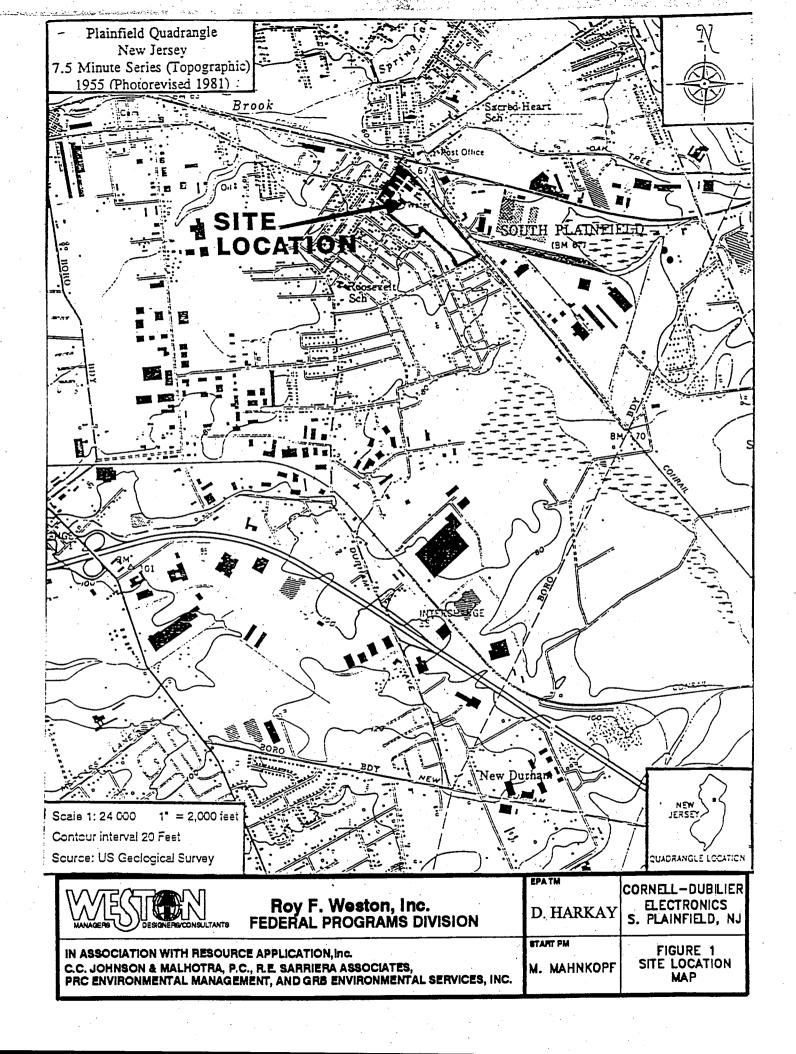

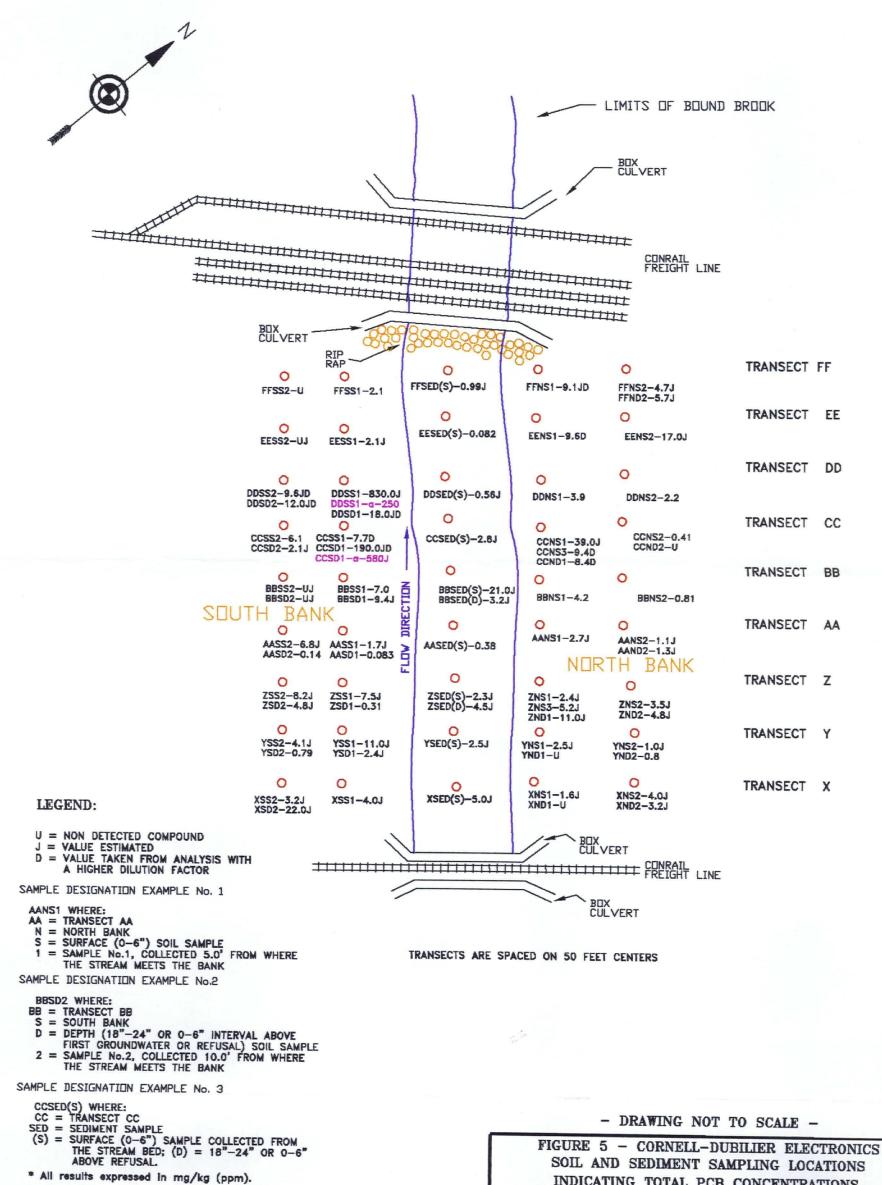

Roy F. Weston, Inc. FEDERAL PROGRAMS DIVISION

IN ASSOCIATION WITH PRC ENVIRONMENTAL MANAGEMENT, INC., C.C. JOHNSON & MALHOTRA, P.C., RESOURCE APPLICATIONS, INC., R.E. SARRIERA ASSOCIATES, AND GRB ENVIRONMENTAL SERVICES, INC. INDICATING TOTAL PCB CONCENTRATIONS.

BOUND BROOK - REACH 3/TRANSECTS X - FF

US EPA REMOVAL ACTION BRANCH


SUPERFUND TECHNICAL ASSESSMENT AND RESPONSE TEAM CONTRACT# 88-W5-DD19

DRAWN BY : J. HAMPTON JR.

EPA TASK MONITOR: D. HARKAY

START PROJECT MANAGER: M. MAHNKOPF

C: \BITMAP\32000B.DWG

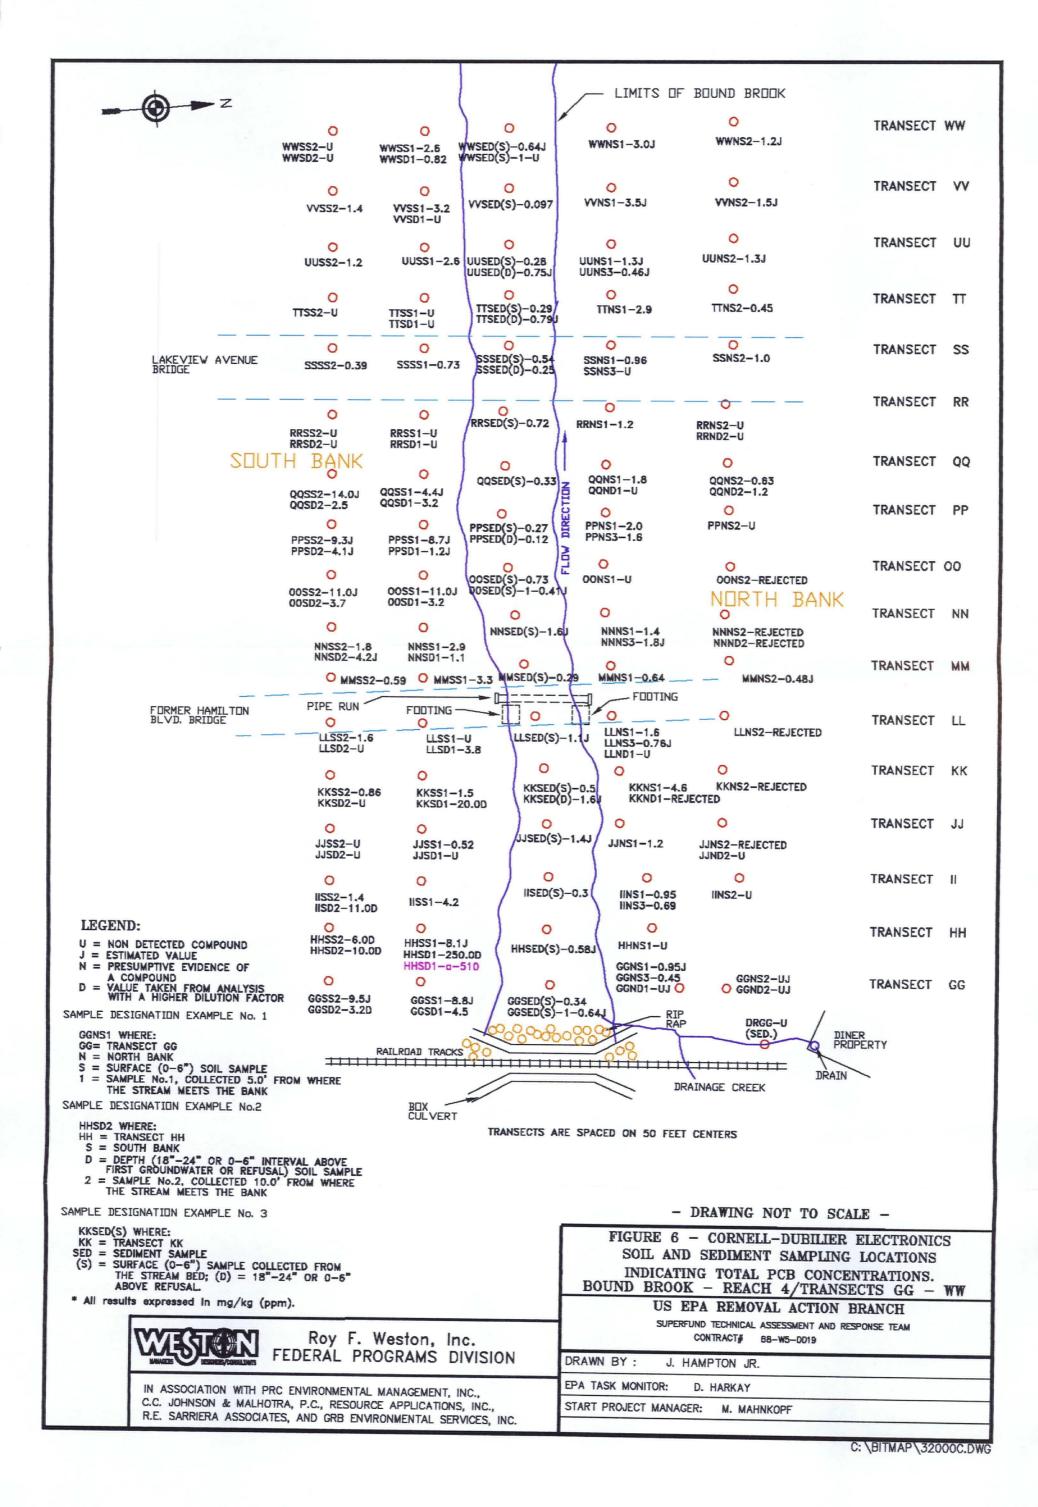

BRIDGE **AVENUE** CLINTON LIMITS OF BOUND BROOK 0 0 0 0 0 TRANSECT WWW WWWNS1-5.3NJD WWWNS2-7.6NJD WWWNS3-7.9NJD WWWND2-2.3NJD WWWSED(S)-3.1N.D WWWSED(D)-0.2N WWWSS2-6.2NJD WWWSS1-7.7NJD WWWSD2-2.8NDJ WWWSD1-7.3NJD WWWND1-7.8NJD TRANSECT VVV 0 0 0 WWWS1-6.2NJD VVVNS2-6.8NJD VVVSS1-7.1NJD vvvsed(s)-2.2nj VVVSS2-1.1NJD VVVND2-7.6NJD VVVND1-3.7NJD VVVSD1-61.0NJD VVVSD2-6.6NJD TRANSECT UUU 0 UUUSS1-2.9ND UUUNS2-8.6ND UUUNS1-7.8ND UUUSED(S)-7.9N.D UUUSED(D)-11.0ND UUUSS2-0.27N UUUSD2-0.89ND UUUSD1-220.0ND UUUSD1-a-2.1 UUUNS3-6.6ND UUUND1-7.1ND UUUND2-4.2ND UUUSD3-a-1.2 0 TRANSECT TTT 0 TTTSS1-33.0ND TTTSS2-1.3ND TTTSED(S)-0.96ND TTTNS1-7.5ND TTTNS2-6.0ND TTTND1-29.0NJD TTTND2-3.6NJD TTTSD2-4.6ND TTTSD1-18.0ND TRANSECT SSS 0 SSSNS2-5.29NJD SSSNS1-4.9NJD SSSNS3-5.32NJD SSSSS1-0.55ND SSSSD1-61.0ND SSSED(S)-5.1NJD SSSED(D)-13.6NJD SSSSS2-0.11N SSSND2-20.8NJD SSSSD2-0.68ND TRANSECT RRR 0 0 RRRSED(S)-1.07ND RRRSED(D)-0.22NJ RRRND1-117.0NJD RRRNS2-4 ORND RRRSS2-0.89NJD RRRSS1-3.6NJD RRRSD2-0.2N RRRSD1-88.0NJD TRANSECT QQQ 0 QQQSED(S)-0.13MJ QQQNS1-9.4NJD QQQSED(D)-2.9NID QQQNS3-8.4NJD QQQND1-40.0NJD QQQNS2-12.0NJD QQQND2-7.5NJD QQQSS2-0.85ND QQQSD2-13.0ND QQQSS1-5.4ND QQQSD1-5.8ND SOUTH BANK o TRANSECT PPP 0 PPPNS1-13.0NJD PPPNS2-10.0ND PPPSED(S)-3.7N PPPNS1-13.0NJD PPPSED(D)-0.81ND PPPND1-32.0ND PPPSS1-2.4ND PPPSS2-2.0ND PPPND2-470.0NJD NORTH BANK PPPSD2-0.28N PPPND2-a-250 0 TRANSECT 000 0 000SED(S)-10.0ND 000NS1-110.0ND 000SED(D)-0.10NJ 000NS3-49.0ND 000ND1-0.97NJD 000SS1-14.0NJD 000SD1-1.4ND 000NS2-13.0ND 000SS2-0.12N 000SD2-9.2ND 000ND2-70.0ND TRANSECT NNN 0 0 NNNSED(S)-2.4NJD NNNSED(D)-2.8NJD NNNNS2-8.0ND NNNNS1-8.7ND NNNND1-150.0ND NNNSS2-9.3ND NNNSD2-14.0NJD NNNSS1-13.0ND NNNSD1-2.1N NNNND2-120.0NJD TRANSECT MMM 0 0 0 MMMSED(S)-17.0JN MMMNS1-13.0NJD MMSED(D)-13.0ND MMMNS3-13.0ND MMMNS2-6.6NJD MMMND2-0.32N MOMMSS2-13.0NJD MMMSS1-18.0NJD MOMOMSD2-38.0NJD DRAINAGE CREEK BRSSED(S)-UJ 🔾 TRANSECT 0 LLL 0 0 LLLNS1-4.41NJD LLLND1-25.0NJD LLLNS2-11.9NJD LLLSS1-15.2NJD LLLSD1-0.142NJ ILLSED(S)-24.0JN ILLSED(D)-2.56NJD LLLSS2-21.0ND LILIND2-7.33NJD LLLSD2-0.104NJ 0 O 0 0 TRANSECT KKK KKKSED(S)-2.7NJ KKKSED(D)-5.8NJ KKKSS2-17.0NJD KKKSS1-33.0NJ KKKNS1-18.0NJ KKKNS3-7.8NJD KKKNS2-8.1NJD KKKSD2-1.1NJ KKKSD1-43.0NJ KKKND2-5.8NJD KKKND1-12.0NJ 0 0 TRANSECT 0 JJJSS2-24.0NJD JJJSS1-50.0NJD JJJNS2-16.0NJD JJSED(S)-4.7NJD JJJSED(D)-5.7NJD JJJNS1-26.0NJD JJJSD2-140.0NJD JJJSD1-170.0NJ JJJND2-7.8NJD JJJND1-1.7JN LEGEND: U = NON DETECTED COMPOUND J = ESTIMATED VALUE TRANSECTS ARE SPACED ON 200 FEET CENTERS N = PRESUMPTIVE EVIDENCE OF A COMPOUND VALUE TAKEN FROM ANALYSIS WITH A HIGHER DILUTION FACTOR SAMPLE DESIGNATION EXAMPLE No. 1 JJJNS1 WHERE: JJJ = TRANSECT JJJ N = NORTH BANK S = SURFACE (0-6") SOIL SAMPLE = SAMPLE No.1, COLLECTED 5.0' FROM WHERE THE STREAM MEETS THE BANK SAMPLE DESIGNATION EXAMPLE No.2 KKKSD2 WHERE:

KKKSJZ WHERE:
KKK = TRANSECT KKK

S = SOUTH BANK

D = DEPTH (18"-24" OR 0-6" INTERVAL ABOVE
FIRST GROUNDWATER OR REFUSAL) SOIL SAMPLE

2 = SAMPLE No.2, COLLECTED 10.0' FROM WHERE
THE STREAM MEETE THE BANK THE STREAM MEETS THE BANK

SAMPLE DESIGNATION EXAMPLE No. 3

LLLSED(S) WHERE: LLL = TRANSECT LLL SED = SEDIMENT SAMPLE
(S) = SURFACE (0-6") SAMPLE COLLECTED FROM
THE STREAM BED; (D) = 18"-24" OR 0-6" ABOVE REFUSAL.

* All results expressed in mg/kg (ppm).

Roy F. Weston, Inc. FEDERAL PROGRAMS DIVISION

IN ASSOCIATION WITH PRC ENVIRONMENTAL MANAGEMENT, INC., C.C. JOHNSON & MALHOTRA, P.C., RESOURCE APPLICATIONS, INC., R.E. SARRIERA ASSOCIATES, AND GRB ENVIRONMENTAL SERVICES, INC. - DRAWING NOT TO SCALE -

FIGURE 8 - CORNELL-DUBILIER ELECTRONICS SOIL AND SEDIMENT SAMPLING LOCATIONS INDICATING TOTAL PCB CONCENTRATIONS. BOUND BROOK - REACH 6/TRANSECTS JJJ - WWW

US EPA REMOVAL ACTION BRANCH

SUPERFUND TECHNICAL ASSESSMENT AND RESPONSE TEAM CONTRACT# 88-W5-DD19

DRAWN BY : J. HAMPTON JR.

EPA TASK MONITOR: D. HARKAY

START PROJECT MANAGER: M. MAHNKOPF

D: \BITMAP\32000E.DWG

APPENDIX 2

ANALYTICAL RESULTS (FORM I's) & DATA VALIDATION PACKAGE

NOVEMBER 21, 1998



Roy F. Weston, Inc.
Federal Programs Division
Suite 201
1090 King Georges Post Road
Edison, New Jersey 08837-3703
908-225-6116 • Fax 908-225-7037

SUPERFUND TECHNICAL ASSESSMENT AND RESPONSE TEAM EPA CONTRACT 68-W5-0019

START-02-F-03327

TRANSMITTAL MEMO

To:

Eric Wilson, OSC

Response and Prevention Branch, U.S. EPA Region II

From:

David Rosenberg, Data Reviewer

START Region II

Subject:

Cornell Dubilier Site, South Plainfield, New Jersey

Data Validation Assessment

Date:

January 18, 1999

The purpose of this memo is to transmit the following information:

• Data validation results for the following parameters:

TCL - Total PCBs

7 samples

Matrices and Number of Samples

Soil/Sediment

6 samples

Water

1 sample

• Sampling date:

November 21, 1998

The final data assessment narrative and original analytical data package are attached.

cc: START PM

Michael Mahnkopf

START FILE TDD #:

02-98-08-0053

TDD #:

02-98-12-0010

PCS #:

4344

U.S. ENVIRONMENTAL PROTECTION AGENCY

MEMORANDUM January 26, 1999 DATE: TO: Eric Wilson, OSC **USEPA Region II** FROM: **David Rosenberg** START Data Review Team **SUBJECT: QA/QC Compliance Review Summary** As requested quality control and performance measures for the data packages noted have been examined and compared to EPA standards for compliance. Measures for the following general areas were evaluated as applicable: Data Completeness Blanks Spectra Matching Quality DFTPP and BFB Tuning Surrogate Spikes Chromatography Matrix Spikes/Duplicates Holding Times Calibration Compound ID (HSL, TIC) Any statistical measures used to support the following conclusions are attached so that the review may be reviewed by others.

Summary of Results

	I II _VOABNA	III IV PEST/PCB HERB
Acceptable as Submitted Acceptable with Comments Unacceptable, Action Pending Unacceptable		
Data Reviewed by:	Ofsenher	Date: 1-24-99
Approved By:	Am Soul	Date: 1/24/99
Area Code/Phone No.:	(732) 225-6116	• 4

NARRATIVE

CASE No. <u>4338</u>

			*
<u>sey</u>			
	·	· -	
7 samples coll	ected on No	vember 2	1, 1998.
receipt of thes	e samples.		
_	Z samples coll		7 samples collected on November 2

The laboratory reported a problem with the analyses of samples for PCBs. Many of the samples contained relatively large amounts of Aroclor 1254 which shares common PCB peaks with Aroclor 1260. The lab found it very difficult to quantitate the amount of Aroclor 1260 since the samples had to be diluted in order to keep the Aroclor 1254 within the calibration range.

The evaluator has commented on the criteria specified under each fraction heading. All criteria have been assessed, but no discussion is given where the evaluator has determined that criteria were adequately performed or require no comment. Details relevant to these comments are given on the forms followed.

Evaluation by Fraction:

III. Pesticides/PCB -

Y Holding Times Y Calibration Linearity

Y Instrument Performance Y Blank

Y Surrogate Recovery Y Retention Time Window

Y MS/MSD Y Analytical Sequence

Y Compound ID Y RT Check for TCX and DCB

Y Chromatography

Comments:

1. Refer to Data Assessment Narrative.

•	•		
Fu	nctional Guidelines for I	Evaluating Organic Analysis	• • • • • • • • • • • • • • • • • • • •
CASE #433	8	SDG #	· ·
LAB: <u>Ecol</u>	ogy & Environment	SITE: Cornell-Dubilie	<u>r </u>
he current Functiona	l Guidelines for evaluating	organic data have been applied	•
N" (presumptive evider	ice for the presence of the n	es which have been qualified winaterial), "U" (non-detects), "R" rial at an estimated value). All	(unusable), or "JN"
nusable. In other was a formation as to wheth ecause they cannot be compound concentrate.	ords, due to significant QC er the compound is present of e relied upon, even as a last	st, the "R" flag means that the problems, the analysis is invalor not. "R" values should not a resort. The second fact to kee QC tests, is guaranteed to be a potentially contains error.	lid and provides no ppear on data tables ep in mind is that no
	ied as "JN" or "R" may not	be used to demonstrate comp	liance with Toxicity
	0:0		
Reviewer's Signature:	UK denlieg	Date: 1 126/1997	3
Verified By:		Date://19	

On 21 November 1998, START personnel collected 6 soil samples, including one duplicate and extra volume for MS/MSD analysis, plus one rinse blank. The samples were submitted to Ecology & Environment Laboratory for PCB analysis.

Client identification (ID) and laboratory ID numbers:

Client ID No.	Laboratory ID No.	Matrix
CCSD1	19591	Soil
DDSS1	19592	Soil
HHSD1	19593	Soil
UUUSD1	19594	Soil
UUUSD3	19595	Soil- duplicate of UUUSD1
PPPND2	19596	Soil
RB-1	19597	Water- rinse blank

1. HOLDING TIMES:

The amount of an analyte in a sample can change with time due to chemical instability, degradation, volatilization, etc. If the specified holding time is exceeded, the data may not be valid. Those analytes detected in the samples whose holding time has been exceeded will be qualified as estimated, "J". The non-detects (sample quantitation limits) will be flagged as estimated, "J", or unusable, "R", if the holding times are grossly exceeded.

The following analytes in the samples shown were qualified because of holding time:

TCL Data

<u>Pest/PCBs</u> - The following data were qualified as estimated "J" or rejected "R" due to exceeding holding time criteria:

Sample ID Matrix Date Sampled Date Extracted Qualifier # Compounds

No problems were found.

Note: Continuous extraction of water samples must be started within seven (7) days of the date of collection. Soil/Sediment/Solid samples must be extracted within seven (7) days of collection. Extracts must be analyzed within forty (40) days of extraction.

2. BLANK CONTAMINATION:

Quality Assurance (QA) blanks [i.e., method, trip, field or rinse blanks] are prepared to identify any contamination which may have been introduced into the samples during sample preparation or field activity. Method blanks measure laboratory contamination. Trip blanks measure cross-contamination of samples during shipment. Field and rinse blanks measure cross-contamination of samples during field operations. If the concentration of the analyte is less than 5 times the blank contaminant level (10 times for common contaminants), the analytes are qualified as non-detects, "U". The following analytes in the samples shown were qualified with "U" for these reasons:

A) Method Blank Contamination

<u>Pest/PCBs</u> - The following compounds were qualified as non-detected "U" in the associated samples due to method blank contamination:

Compound			Associated Samples
Aroclor-1016 Aroclor-1221 Aroclor-1232 Aroclor-1242 Aroclor-1248	No problems were found.		
Aroclor-1254 Aroclor-1260	No problems were found. No problems were found.		

B) Field or Rinse Blank Contamination ("water blanks" or "distilled water blanks" are validated like any other sample)

<u>Pest/PCBs</u> - The following compounds were qualified as non-detected "U" in the associated samples due to rinse blank contamination:

Compound

Associated Samples

No problems were found.

4. CALIBRATION:

Satisfactory instrument calibration is established to ensure that the instrument is capable of producing acceptable quantitative data. An initial calibration demonstrates that the instrument is capable of giving acceptable performance at the beginning of an experimental sequence. The continuing calibration verifies that the instrument is giving satisfactory daily performance.

Response Factor:

The response factor measures the instrument's response to specific chemical compounds. The response factor for the VOA/BNA Target Compound List (TCL) must be ≥ 0.05 in both the initial and continuing calibrations. A value ≤ 0.05 indicates a serious detection and quantitation problem (poor sensitivity). If the mean RRF of the initial calibration or the continuing calibration has a response factor < 0.05 for any analyte, those analytes detected in environmental samples will be qualified as estimated "J". All non-detects for those compounds will be rejected "R". The following analytes in the samples shown were qualified because of response factor:

Initial Calibration

No problems were found.

5. CALIBRATION:

PERCENT RELATIVE STANDARD DEVIATION (%RSD) AND PERCENT DIFFERENCE (%D):

Percent RSD is calculated from the initial calibration and is used to indicate the stability of the specific compound response factor over increasing concentration. Percent D compares the response factor of the continuing calibration check to the mean response factor (RRF) from the initial calibration. Percent D is a measure of the instrument's daily performance. Percent RSD must be < 30% and %D must be < 25%. A value outside of these QC limits indicates potential detection and quantitation errors. For these reasons, all positive results are flagged as estimated, "J"; and non-detects are flagged "UJ". If %RSD and/or %D grossly exceed QC criteria, non-detect data may be qualified "R".

For the PESTICIDE/PCB fraction, if %RSD exceeds 20% for all analytes except for the 2 surrogates (which must not exceed 30% RSD), qualify all associated positive results "J" and non-detects "UJ".

The following analytes in the samples shown were qualified for %RSD and %D:

Initial Calibration

<u>Pest/PCBs</u> - The following compounds were qualified as estimated "J" or rejected "R" in the associated samples because the linearity criteria or the percent relative standard deviation (%RSD) of the Initial Calibration is > 20% for either one or both GC columns:

Compound

Percent Recovery Qualifier

Associated

Sample(s)

No problems were found.

Continuing Calibration:

<u>Pest/PCBs</u> - The Percent Difference (%D) for PEM compound amounts in the continuing calibration verification analyses and/or the %D amounts in the Individual Standard Mixes of the continuing

calibration verification analyses are ≥ 25% for either one or both GC columns. The following compounds were either qualified as estimated "J" or rejected "R" due to exceeding Continuing Calibration QC criteria:

Compound

RPD

Oualifier

Associated Sample(s)

No problems were found.

<u>Pest/PCBs</u> - The following compounds were qualified as estimated "J" in the associated samples because the Continuing Calibration %D is between 25-90% for these compounds on the primary GC column:

Compound

Associated Samples

No problems were found.

6. SURROGATES/SYSTEM MONITORING COMPOUNDS (SMC):

All samples are spiked with surrogate/SMC compounds prior to sample preparation to evaluate overall laboratory performance and efficiency of the analytical technique. If the measured surrogate/SMC concentrations were outside contract specifications, qualifications were applied to the samples and analytes as shown below. The following analytes for the samples shown were qualified because of surrogate/SMC recovery:

<u>Pest/PCBs</u> - The following compounds were either qualified as estimated "J" or rejected "R" due to Tetrachloro-m-xylene (TCX) and Decachlorobiphenyl (DCB) surrogate recoveries are both outside specified advisory QC limits (30-150%):

Surrogate

Recovery

Qualifier Compounds

Sample(s)

No problems were found.

8. COMPOUND IDENTIFICATION:

B) PESTICIDE FRACTION:

The retention time of the reported compounds must fall within the calculated retention time windows. The following analytes in the samples shown were qualified because of compound identification:

<u>Pest/PCBs</u> - The following detected compounds were qualified due to failure to show at least 3 major peaks within the established windows corresponding to each multi-component analyte.

Compound

%D

Oualifier

Sample(s)

No problems were found.

Note: These samples were analyzed using EPA Method 8082 which is a single column gas chromatographic procedure.

Note: During the initial calibration sequence, absolute retention times are determined for all single response pesticides, the surrogates, and at least three major peaks of each multi-component analyte. Windows are centered around the mean absolute retention time for the analyte established during the initial calibration. Analytes are identified when peaks are observed in the retention time window. Comparison of the sample retention times to the retention time windows established during the initial calibration revealed that no additional pesticide compounds were detected in the associated samples. In addition, no shifts for surrogate compound retention times were noted to occur that might require consideration of compounds outside respective retention time windows.

9. MATRIX SPIKE/SPIKE DUPLICATE (MS/MSD):

The MS/MSD data are generated to determine the long-term precision and accuracy of the analytical method in various matrices. The MS/MSD may be used in conjunction with other QC criteria for some additional qualification of the data. The following analytes, for the samples shown, were qualified because of MS/MSD:

<u>Pest/PCBs</u> - The following sample data were either qualified as estimated "J" or rejected "R" due to exceeding duplicate spike recovery QC criteria:

No problems were found, except that the recovery of Aroclor 1260 was in excess due to overlapped peaks of the high sample amount of Aroclor 1254.

10. OTHER QC DATA OUT OF SPECIFICATION:

No problems were found.

<u>Pest/PCBs</u> - The following compounds were qualified as estimated "J" in the associated aqueous and/or soil/sediment field duplicate samples because the Relative Percent Difference (RPD) between the sample and field duplicate sample is > 50% for aqueous samples, or > 100% for soil/sediment samples:

Compound Matrix % RPD Associated Field Duplicate Samples

No problems were found.

The following soil/sediment/solid sample data (other than TCLP data) were either qualified as estimated "J" (% moisture between 50-90%) or rejected "R" (% moisture > 90%) because the sample contains more than 90% water:

Fraction	Percent Moisture	Qualifier	# Compounds	Sample(s)
	- -		:	
Pest/PCBs	58.4	J	Aroclor 1254	CCSD1

11. SYSTEM PERFORMANCE AND OVERALL ASSESSMENT:

Due to professional judgement, the following compounds were not transferred from the indicated dilution sample analyses to the undiluted sample analyses because the reported values of these compounds are either diluted out in the associated dilution sample analyses or are qualified as non-detected "U" due to blank contamination QC criteria:

Fraction Compound Dilution Sample(s) Dilution Factor

No problems were found.

Due to professional judgement, the following positive data were rejected "R" due to possible carryover from

a previous sample analysis that contained the compound(s) at high concentration(s):

Fraction

Sample Compound

Sample Compound

Previous Sample

Concentration

Compound Concentration

No problems were found.

12. CONTRACT PROBLEMS/NON-COMPLIANCE:

The laboratory report did not quantify Aroclor 1260 because there were large amounts of Aroclor 1254 whose peaks overlapped with many of the Aroclor 1260 peaks. The samples were analyzed at high dilutions in order to bring the Aroclor 1254 within the calibration range. This resulted in diluting the Aroclor 1260 below the practical level of identification and quantification.

The initial laboratory report did not include the corrections of the data for reporting on the dry weight basis. The laboratory was required to measure the moisture content of the samples and they submitted corrected Form Is.

PCB DATA TABLE

PROJECT: Cornell-Dubilier

SDG# 4338

SOIL: Low Concentration

Sample #/Concentration (ug/Kg)

Sample Date	11/21/98	11/21/98	11/21/98	11/21/98	11/21/98	11/21/98			
Sample ID	CCSD1-A	DDSS1-A	HHSD1-A	UUUSD1-A	UUUSD3-A	PPPND2-A		ŧ.	i.
Lab ID	EE-98-19591	EE-98-19592	EE-98-19593	EE-98-19594	EE-98-19595	EE-98-19596			
% Moisture	58%	23%	40%	28%	22%	48%	•		5
Dilution Factor	2000	2000	2000	10	10	1000			
Aroclor-1016	96000 U	52000 U	66000 U	280 U	260 U	38000 U		ŧ	
Aroclor-1221	192000 U	100000 U	130000 U	560 U	510 U	77000 U			
Aroclor-1232	96000 U	52000 U	66000 U	280 U	260 U	38000 U			
Aroclor-1242	96000 U	52000 U	66000 U	280 U	260 U	38000 U			
Aroclor-1248	96000 U	52000 U	66000 U	280 U	260 U	38000 U			
Aroclor-1254	580000 J	250000	510000	2100	1200	250000			
Aroclor-1260	96000 U	52000 U	66000 U	280 U	260 U				
Total PCB (mg/Kg)	580 J	250	510	2.10	1.20	250			

U - Non-detected compound.

B - Compound detected in the associated Method Blank.

J - Estimated value.

JN - Presumptive evidence of a compound at an estimated value.

R - Rejected compound.

PCB DATA TABLE

PROJECT: Cornell-Dubilier

SDG# 4338

WATER: Low Concentration

Sample #/Concentration (ug/L)

Campio meanion		1	T	1	1	7	T	 [
Sample Date	11/21/98			·					
Sample ID	· RB-1								·
Lab ID	EE-98-19597								
% Moisture		·							
Dilution Factor	1.0								
Aroclor-1016	0.5 U								
Aroclor-1221	1.0 U								
Aroclor-1232	0.5 U				· .			 	
Aroclor-1242	0.5 U			•					
Aroclor-1248	0.5 U								
Aroclor-1254	0.5 U							 	
Aroclor-1260	0.5 U								:

U - Non-detected compound.

B - Compound detected in the associated Method Blank.

J - Estimated value.

JN - Presumptive evidence of a compound at an estimated value.

R - Rejected compound.

FP.No.:	CHAIN U	F CU	JST	Yעט	KEC	CKD	Matrix	Box No		Preservative Box No.
4338	7				•		2. Grod	- Water	DEC	1-HCl 2. HN03 3. Na2SO4 4. HZSO4
98700	SUPERFUND TE					ISE TEAM	5. Soil/			S. Other (Specify)
				68-W5-001 = 908-72-7			6. Oil			N. Not Proceed
		HE 900-1		استرس ب	 ,		1 —	- : (Specify	r) .	• See Comment
end vertial and written results to: Roy F. Westen, Inc., USEPA Region II START String 201, 1090 King Georges Post Road, Edison, New Jersey 08837-3703 Attention: Smits Sumbally, START Analytical Coordinator										
Sample Number	Sample Collection MM/DD/YY/Time									CTHER
		Center Ma	d-M Comp d-H Grab-	-C Œ	TON BROK					· · · · · · · · · · · · · · · · · · ·
CCSD1-a	11/2/198 100	5	LIG	- 6		X				
DDSS1-a	2005					X				
HHSDIA	1025					17		·		
UUUSDI~a	1045								<u> </u>	MS/MSD
<u> ~802500</u>	1045	 				1 1				
PPPNDL-a	1120	4	1 1 1							
RB-1	1100	4	1 1	#		1 1 1				
	1									
										
Comments:		``,							·	
Person Assuming Re	Exponsibility for Sample	•							Time 1245	Date (MM/DD/YY)
Sample Number	Relinquished By: M. M.L.	Luf	Tim	Desce	Roccived	ed ex	? :		Shir	T Change of Custody
Sample Number	Reinquished By:		Tir ()	ا کو الم	Received	By: / (l) l	cad	•	Lèce Sa	ingles
Sammie Number	Relinquished By:		Tir	ne IDare	Received	Bv:			Resson i	or Change of Custody

Roy F. Weston, Inc.

FEDERAL PROGRAMS DIVISION

Job number: 9803.017

Batch number: 981129305P/981125398P

Roy F. Weston

DEC 6 1948

Narrative

PCBs

The column used for this analysis was a RTX-5, 30 m.

No PCB's were found in the water sample. Nothing unusual to report about the water sample analysis.

The reporting limits were raised according to the percent solids present in the samples.

Aroclor 1254 was found in the soil samples.

The soil samples were analyzed at secondary dilutions and quantitation limits raised accordingly. In samples CCSD1-A, DDSS1-A, HHSD1-A and PPPND2-A the surrogate recoveries were diluted out.

The UUUSD1-A MS/MSD was analyzed at a secondary dilution. The sample contained Aroclor 1254 which co-eluted with the Aroclor 1260 spike recoveries causing them to be elevated outside the QC Limits.

The laboratory control samples (LCS) spike recoveries, remaining surrogates and method blank met QC criteria.

Initial and continuing calibration standards met method criteria. Initial calibration data for both waters and soils is in the water section of this report.

Gary Rudz, Senior Chemist

JOB NUMBER : 9803.017

Ecology and Environment, Inc. SAMPLE TRACKING REPORT

- SAMPLE NUMBER	CLIENT SAMPLE ID		DATE SAMPLED	DATE EXTRACTED	DATE ANALYZED
8082 PCB		-S	•		11
19591.01	CCSD1-A	•	11/21/98	11/24/98	12/03/98
19592.01	DDSS1-A		11/21/98	11/24/98	12/03/98
19593.01	HHSD1-A		11/21/98	11/24/98	12/03/98
19594.01	UUUSD1-A 7	1 1 - 2-0	11/21/98	11/24/98	12/02/98
19595.01	UUUSD3-A	duplicates	11/21/98	11/24/98	12/02/98
19596.01	PPPND2-A	4	11/21/98	11/24/98	12/03/98
8082 PCB		−W	 · · · · · · · · · · · · · · · · · · ·		
19597.01	RB-1		11/21/98	11/25/98	11/25/98

JOB NUMBER :9803.017

ELAP ID : 10486

Ecology and Environment, Inc. Analytical Services Center

CLIENT

: ROY F. WESTON - EDISON CLIENT : ROY F. WESTON TEST NAME : 8082 PCB

TEST NAME : 8082 PCB UNITS : UG/L SAMPLE ID LAB : EE-98-19597 MATRIX: WATER SAMPLE ID CLIENT: RR-1 SAMPLE ID CLIENT: RB-1

PARAMETER	RESULTS	Q	QNT. LIMIT
		-	
PCB-1242	ND		0.50
PCB-1254	ND		0.50
PCB-1221	ND		1.0
PCB-1232	ND		0.50
PCB-1248	ND		0.50
PCB-1260	ND ·		0.50
PCB-1016	ND		0.50

QUALIFIERS: C = COMMENT ND = NOT DETECTED J = ESTIMATED VALUE B = ALSO PRESENT IN BLANK

N = ANALYTE WAS NOT CONFIRMED BY ALTERNATE PROCEDURE

JOB NUMBER :9803.017

ELAP ID : 10486

Ecology and Environment, Inc. Analytical Services Center

CLIENT : ROY F. WESTON - SOLIDS : 41.6% RESULTS IN DRY WEIGHT \$SOLIDS : UG/KG UNITS : UG/KG WATRIX : SOLID CLIENT : ROY F. WESTON - EDISON

SAMPLE ID CLIENT: CCSD1-A

PARAMETER		RESULTS	Q	QNT. LIMIT
			-	
PCB-1242		ND		96000
PCB-1254		580000	· J	96000
PCB-1221		ND ·		192000
PCB-1232		ND		96000
PCB-1248	•	ND		96000
PCB-1260		ND		96000
PCB-1016	•	ND		96000

QUALIFIERS: C = COMMENT ND = NOT DETECTED

J = ESTIMATED VALUE B = ALSO PRESENT IN BLANK

" N = ANALYTE WAS NOT CONFIRMED BY ALTERNATE PROCEDURE

JOB NUMBER :9803.017

ELAP ID : 10486

Ecology and Environment, Inc. Analytical Services Center

CLIENT : ROY F. WESTON - EDISON

%SOLIDS : 76.7% RESULTS IN DRY WEIGHT

TEST NAME : 8082 PCB UNITS : UG/KG SAMPLE ID LAB : EE-98-19592 MATRIX : SOLID

SAMPLE ID CLIENT: DDSS1-A

]	PARAMETER	RESULTS	Q	QNT. LIMIT
			 .	
.]	PCB-1242	ND		52000
1	PCB-1254	250000		52000
:	PCB-1221	ND		100000
:	PCB-1232	ND		52000
:	PCB-1248	ND		52000
	PCB-1260	ND		52000
	PCB-1016	ND		52000

QUALIFIERS: C = COMMENT ND = NOT DETECTED J = ESTIMATED VALUE B = ALSO PRESENT IN BLANK

N = ANALYTE WAS NOT CONFIRMED BY ALTERNATE PROCEDURE

JOB NUMBER :9803.017

ELAP ID : 10486

Ecology and Environment, Inc. Analytical Services Center

CLIENT : ROY F. WESTON - EDISON

RESULTS IN DRY WEIGHT

%SOLIDS : 60.3%

TEST NAME : 8082 PCB

UNITS : UG/KG

SAMPLE ID LAB : EE-98-19593 SAMPLE ID CLIENT: HHSD1-A

MATRIX : SOLID

PARAMETER	RESULTS	Q	QNT. LIMIT
		-	
PCB-1242	ND		66000
PCB-1254	510000		66000
PCB-1221	ND		130000
PCB-1232	ND .		66000
PCB-1248	ND		66000
PCB-1260	ND		66000
PCB-1016	ND		66000

N = ANALYTE WAS NOT CONFIRMED BY ALTERNATE PROCEDURE

JOB NUMBER :9803.017

ELAP ID : 10486

Ecology and Environment, Inc. Analytical Services Center

CLIENT : ROY F. WESTON - EDISON

RESULTS IN DRY WEIGHT **%SOLIDS** : 71.6% UNITS : UG/KG MATRIX : SOLID TEST NAME : 8082 PCB

SAMPLE ID LAB : EE-98-19594

SAMPLE ID CLIENT: UUUSD1-A

 PARAMETER	RESULTS	Q	QNT. LIMIT
		- .	
PCB-1242	ND		280
PCB-1254	2100		280
PCB-1221	ND		560
PCB-1232	ND		280
PCB-1248	ND		280
PCB-1260	ND		280
PCB-1016	ND		280

QUALIFIERS: C = COMMENT ND = NOT DETECTED

J = ESTIMATED VALUE B = ALSO PRESENT IN BLANK

N = ANALYTE WAS NOT CONFIRMED BY ALTERNATE PROCEDURE.

JOB NUMBER :9803.017

ELAP ID : 10486

Ecology and Environment, Inc. Analytical Services Center

CLIENT : ROY F. WESTON - EDISON

%SOLIDS : 78.1% RESULTS IN DRY WEIGHT TEST NAME : 8082 PCB UNITS : UG/KG MATRIX : SOLID SAMPLE ID LAB : EE-98-19595 SAMPLE ID CLIENT: UUUSD3-A

PARAMETER	RESULTS	Q	QNT. LIMIT
		-	
PCB-1242	ND		260
PCB-1254	1200	•	260
PCB-1221	ND		510
PCB-1232	ND		260
PCB-1248	ND		260
PCB-1260	ND		260
PCB-1016	ND		260

QUALIFIERS: C = COMMENT ND = NOT DETECTED

J = ESTIMATED VALUE B = ALSO PRESENT IN BLANK

N = ANALYTE WAS NOT CONFIRMED BY ALTERNATE PROCEDURE

JOB NUMBER :9803.017

ELAP ID : 10486

Ecology and Environment, Inc. Analytical Services Center

CLIENT : ROY F. WESTON - EDISON

%SOLIDS : 52.1% RESULTS IN DRY WEIGHT UNITS : UG/KG TEST NAME : 8082 PCB MATRIX : SOLID SAMPLE ID LAB : EE-98-19596


SAMPLE ID CLIENT: PPPND2-A


PARAMETER	RESULTS	Q	QNT. LIMIT
		-	
PCB-1242	ND		38000
PCB-1254	250000		38000
PCB-1221	ND		77000
PCB-1232	ND		38000
PCB-1248	ND		38000
PCB-1260	ND		38000
PCB-1016	ND		38000


QUALIFIERS: C = COMMENT ND = NOT DETECTED

J = ESTIMATED VALUE B = ALSO PRESENT IN BLANK

N = ANALYTE WAS NOT CONFIRMED BY ALTERNATE PROCEDURE

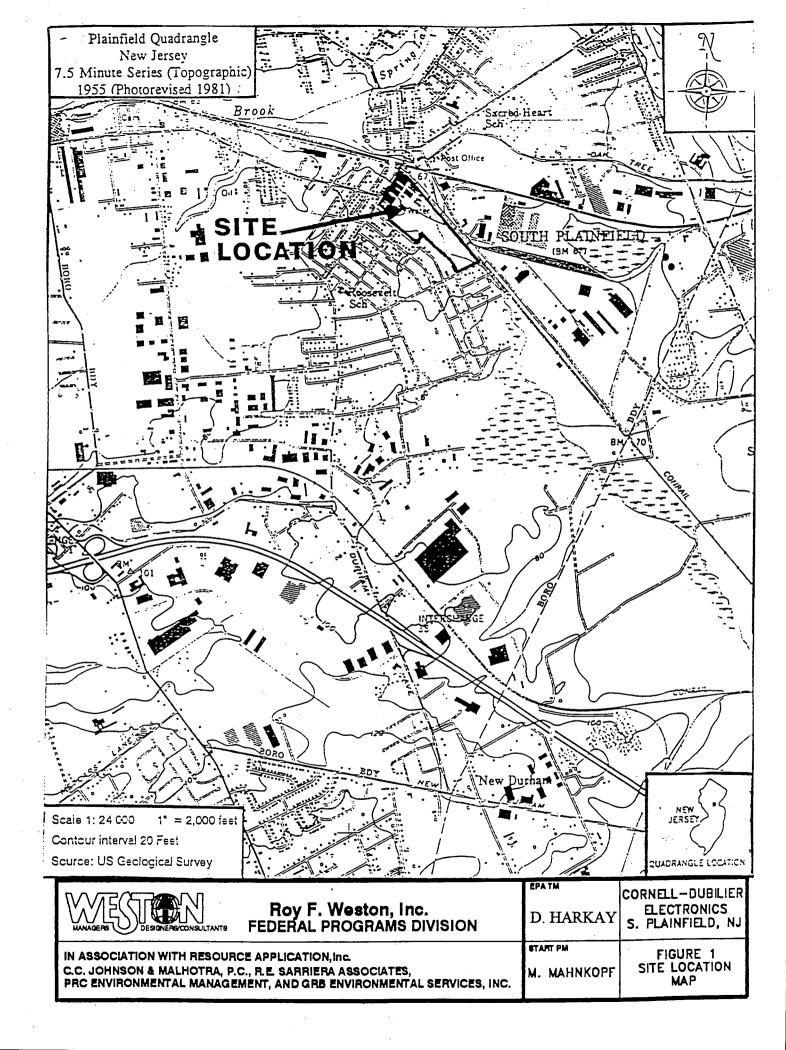

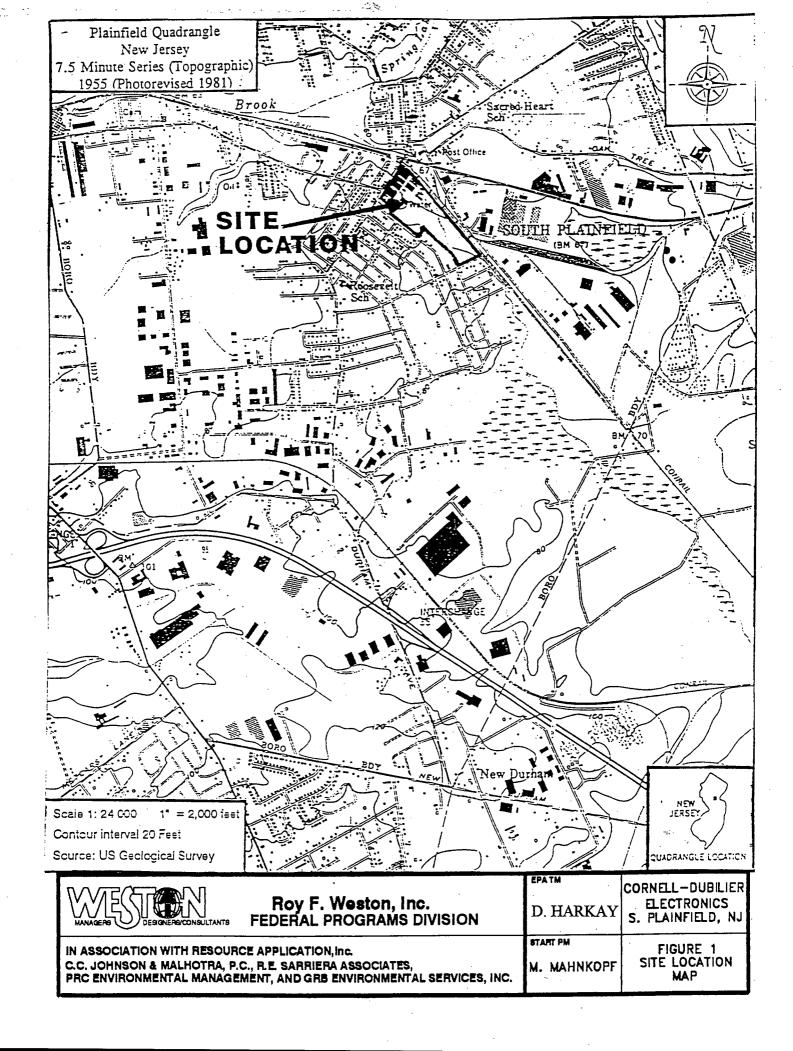

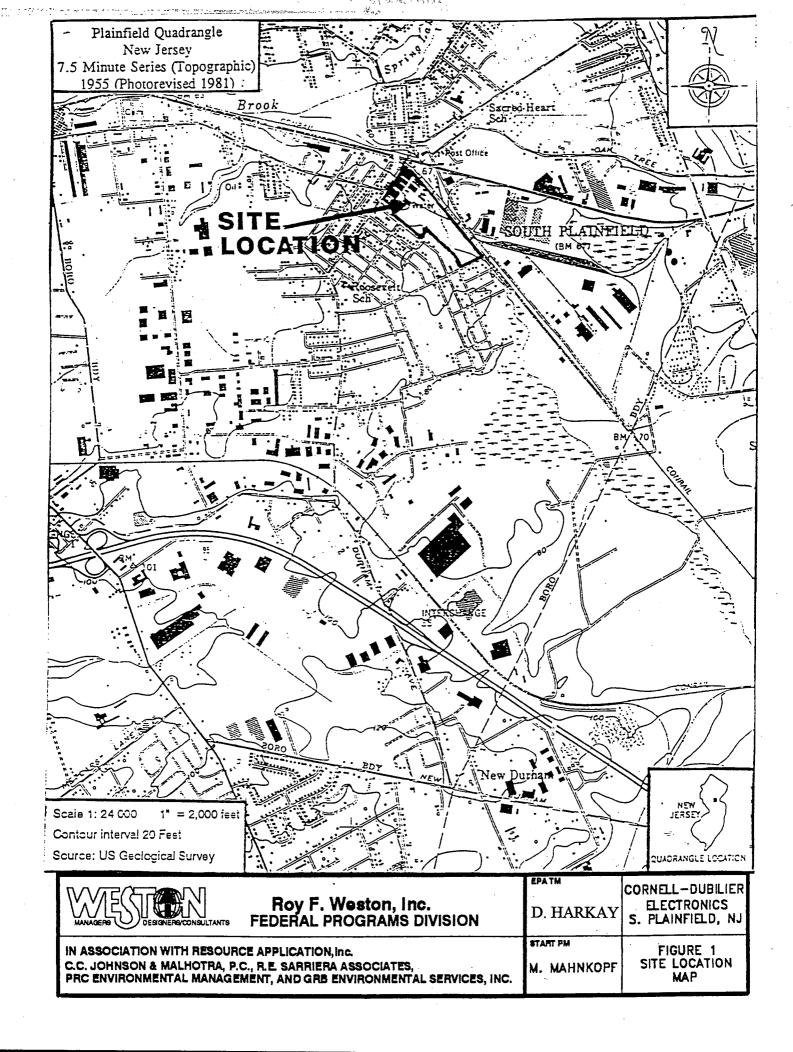

RFP No.:	CHAII U	F C	JUS	STO	IJΥ	K	上(\mathcal{L}	KI) x	Ast i	ix B	ox N	o. :	Preser	vztive Box No.:
					·					l	. Se	rface	Wete	r	1. HC	
4338	· 7	$\mathbf{Y}\mathbf{Y}$	न र	7 17 A						2	. Gr	bewo	Wate	t	2. HN0	3
PO No.:	· '	$\backslash \mathcal{M}$	<u>L-2)</u>	门回	لللخ	•				3	. Le	echer	.		3. Na25	104
	•	- WWGE	-s C	DESIDIERS	COGULINUS			·		4	. Ri	nseto			4. H2S	D4
98700	SUPERFUND T	CHNIC	:AL AS	MZZZZ	ENT AN	D RE	SPO	SE T	EAM			il/Sed			5. Othe	r (Specify)
10/00				ACT 68							. Oi	1			6. Ice C)nly
 -	P	5anc: 90	4- <u>77</u> 5-5	116 F±=	904-725-	7227				- 1		LEC			-	Preserved
a a				<u> </u>								ber (5	pecif	y)	• Sœ	Сотпеля
Send verbal and w	nium resuits to:		-	. West				_								
					_		_								08837-370	3
			Attent	ion: Si	nica Sur	nibaiy	, Sī	ART	Ans	iytic	al (Coon	iinat	or		
Sample Number	Sample Collection	Samoic	Cooc.	Semple	Sempic		···· PA	SANA	CYSIS			BCZY	ANA	LYSIS		
_	MM/DD/YY/Time	Metrix	Low-L	Type	Preserv.	YOA	BNA	7231	rc34	IALI	24	KEN	COR!	REAC		HER
		' 1		Co mp -C	1 1				1				.	1		
		bax #	H igh -H	Gab-G	bezz #a)			1		_ +			1	<u> </u>		
CCSD1-a	11/21/98 1000	5	L	6	6				X							
DDSS1-a	10.05	, ,		1					X			1				• .
א וכנעק									V	一	i			i		
HHSDIO	1025								<u> </u>	_	_			<u> </u>		
UUUSDI~a	1045								X			-			MSI	MSD
UUUSD3~	1045								X	.	·	·				
PPPNDL-a	1120.	V							X							
RB-1					1				V							· · · · · · · · · · · · · · · · · · ·
RP I	1100	4	Y	4	<u>'</u>		<u> </u>	1	1	_					<u> </u>	
												•				
-											·					
				<u> </u>		 	 									
	<u> </u>	<u> </u>	<u> </u>		<u> </u>											
Comments:	•	• •														
-									_							
Person Assuming Re	sponsibility for Sample:			,										Time 124	Date 11	(MM/DD/YY) Ulqq
Sample Number	Relinquished By:		-	Time	Date]	Recc	ived	Ву:						Ressor	for Change	of Custody
ALL	M. Maky	Leef.	•	12xx	1/3/63											
Sample Number	Reinquished By:	/		Time	Date	Rece	ived .	By:						Ressor	tor Change	of Custody

Reason for Change of Custody

Roy F. Weston, Inc.

Sampie Number

FEDERAL PROGRAMS DIVISION

Relinquished By:

Time |Date

Received By:

Precautionary Measures Against Hidden Hazards in Laboratory Samples

Notice to Laboratory Personnel

Background

Under the authority of Section 104 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA or Superfund) of 1980, Section 311 of the Clean Water Act, and Subtitle I of the Resource Conservation and Recovery Act (RCRA), EPA has been delegated the responsibility to undertake response actions with respect to the release or potential release of oil, petroleum, or hazardous substances that pose a substantial threat to human health or welfare, or the environment. In addition, EPA provides technical assistance to help mitigate endangerment of the public health, welfare or environment during other emergencies and natural disasters.


EPA's successful implementation of these emergency response action responsibilities requires that technical support capabilities be provided in the form of a contracted Superfund Technical Assessment and Response Team (START) for each EPA Region. The WESTON START Contract 68-W5-0019 provides support to EPA Region II.

Hazard Communication

The samples which accompany this notice have been shipped to your laboratory for analysis in accordance with applicable D.O.T. or IATA Regulations and were collected by the WESTON START and were tentatively designated by the field response team as either environmental or hazardous material samples.

In general, Environmental Samples are collected from streams, farm ponds, small lakes, wells, and off-site soils that are not reasonably expected to be contaminated with hazardous materials. Samples of on-site soils or water, and materials collected from drums, bulk storage tanks, obviously contaminated ponds, impoundments, lagoons, pools, and leachates from hazardous waste sites are considered Hazardous Samples. Samples which are obtained from a known radioactive material contamination site or which demonstrate beta or gamma activity greater than three times average background as scanned with a Geiger-Mueller radiation survey meter are considered Radioactive Samples.

The samples which accompany this notice have been tentatively classified by the field response team as:
Environmental Hazardous Comb. (Envir.& Haz.) Radioactive
The field team which collected the samples used the following Level(s) of personal protection as designated by EPA and OSHA conventions to provide protection against possible radiological or chemical exposure: Level A Level B Level C Level D
This information is intended for use as a guide for the safe handling of these laboratory samples in accordance with EPA and OSHA regulations. The sample classification(s) and Levels of personal protection used by the WESTON START are not represented to be, nor are they adequate or applicable in all situations, nor are the intended to serve as substitutes for professional/personal judgement.
This form was prepared by: M. Markoff Date 1 / 21 / 98
Analytical Services TDD No Date//
WESTON Office: Region II START, Edison, NJ Phone: 732-225-6116 FAX: 732-225-7037
Laboratory Name: Fcology & ENV. FNS
/Hazcom for Laboratory Personnel/ To be attached to each Chain-of-Custody Form

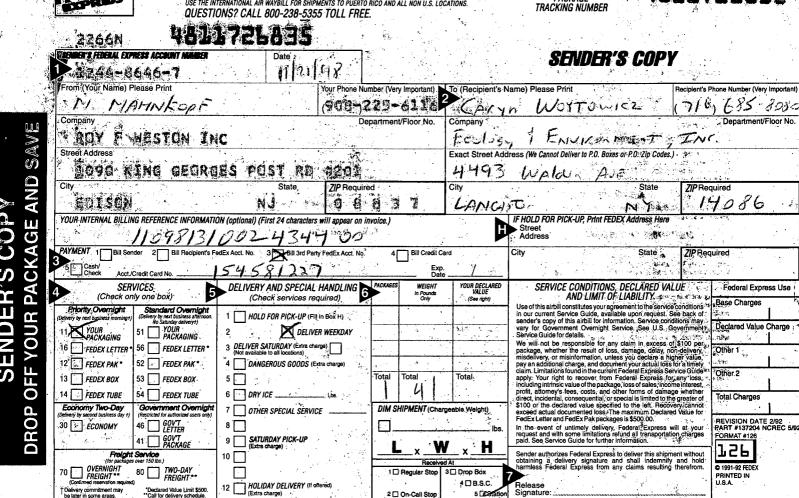

USE THIS AIRBILL FOR SHIPMENTS WITHIN THE CONTINENTAL U.S.A., ALASKA AND HAWAII. USE THE INTERNATIONAL AIR WAYBILL FOR SHIPMENTS TO PUERTO RICO AND ALL NON U.S. LOCATIONS.

4811726835

PACKAGE

Recipient's Phone Number (Very Important)

Department/Floor No.

Total Charges

PART #137204 NCREC 5/92 FORMAT #126 756

© 1991-92 FEDE) PRINTED IN

DEFINITIONS

On this Airbill, we, our and us refer to Federal Express Corporation, its employees and agents. You and your refer to the sender, its employees and agents.

AGREEMENT TO TERMS

By giving us your package to deliver, you agree to all the terms of this Airbill and in our current Service Guide, which is available upon request, if there is a conflict between the current Service Guide and this Airbill, the Service Guide will control. No one is suthorized to alter or modify the terms of our Agreement.

RESPONSIBILITY FOR PACKARING AND COMPLETING AIRBILL

You are responsible for adequately packaging your goods and for properly filling out this Airbill. Omission of the number of packages and weight per package from this Airbill will result in a billing based on our best estimate of the number of packages received from you and an estimated "defaulf" weight per package, as determined and periodically adjusted by us.

AIR TRANSPORTATION TAX INCLUDED

with actual or apparent authority.

Our basic rate includes a federal tax required by Internal Revenue Code Section 4271 on the air transportation portion of this service.

LIMITATIONS ON OUR LIABILITY AND LIABILITIES NOT ASSUMED

Our liability for loss or damage to your package is limited to your actual damages or \$100, whichever is less, unless you pay for and declare a higher authorized value. We do not provide cargo liability insurence, but you may pay an additional charge for each additional \$100 of declared value, if you declare a higher value and pay the additional charge, our liability will be the lesser of

your declared value or the actual value of your package.

In any event we will not be liable for any damages, whether direct, incidental, special or consequential in excess of the declared value of a shipment, whether or not Federal Express had knowledge that such damages might be incurred including, but not limited to, toss of income or

We won't be liable for your acts or omissions, including but not limited to improper or insufficient packing, securing, marking or addressing, or for the acts or omissions of the recipient or anyone else with an interest in the package. Also, we won't be liable, if you or the recipient violates any of the terms of our Agreement. We won't be liable for lose of or damage to shipments of prohibited items. We wan't be liable for loss, damage or delay caused by events we cannot control, including but not limited to acts of God, perils of the air, weather conditions, acts of public enemies, war, strikes, civil

commotions, or acts or omissions of public authorities (including customs and quarantine officials) DECLARED VALUE LIMITS

The highest declared value we allow for FedEx Letter and FedEx Pak shipments is \$500. For other shipments, the highest declared value we allow is \$25,000 unless your package contains items of extraordinary value," in which case the highest declared value we allow is \$500, items of adraordinary value include artwork lewelry fure, precious metals; negotiable instruments, and other items listed in our current Service Guide.

If you send more than one package on this Airbill, you may fill in the total declared value for all packages, not to exceed the \$100, \$500 or \$25,000 per package limit described above. (Example: 5

packages can have a total declared value of up to \$125,000.) If more than one package is shipped on this Airbill, our liability for loss or damage will be limited to the actual value of the package(s) lost or damaged (not to exceed the lesser of the total declared value of the per package limits described above). You have the responsibility of proving the actual loss or damage.

FILING A CLAIR

ALL CLAIMS MUST BE MADE BY YOU IN WRITING. You must notify us of your claim within strict time limits. See current Service Guide.

We'll consider your claim filed if you call and notify our Customer Service Department at 800-238-5355 and notify us in writing as soon as possible.

Within 90 days after you notify us of your claim, you must send us all relevant information about it." We are not obligated to act on any claim until you have paid all transportation charges, and you may not deduct the amount of your claim from those charges. If the recipient accepts your package without noting any damage on the delivery record; we will in

assume that the package was delivered in good condition. In order for us to process your claim, you must, to the extent possible, make the original shipping cartons and packing available for inspection.

ALBORIO TO TAKE COLORO OF THE RIGHT TO INSPECT OF THE CANADA CANADA

We may at our option, open and inspect your packages ofter to or after you give them to us to " ?

MO C.O.D. SERVICES

NO C.O.D. SERVICES ON THIS AIRBILL. If C.O.D Service is required please use a Federal Express C.O.D. airbill for this purpose.

RESPONSIBILITY FOR PAYMENT

Even if you give us different payment instructions, you will always be primarily responsible for all delivery costs; as well as any cost we may incur in either returning your package to you or warehousing it pending disposition.

RIGHT OF REJECTION

We reserve the nort to reject a shipment at any time, when such shipment would be likely to cause \$\frac{1}{2}\$ damage or delay to other shipments, equipment or personnel, or if the transportation of which is prohibited by law or is in violation of any rules contained in this Airbill or our current Service Guide.

MONEY-BACK GUARANTEE

In the event of untimely delivery. Federal Express will at your request and with some limitations. refund or credit all transportation charges. See current Service Guide for further information.

Part # 137204/137205